

Air junctions with female threads & coupling sockets NW 7.2

Materials: Body: Brass, seals: NBR

Temperature range: -20°C to max. +100°C

Operating pressure: 0 - 35 bar as well as large vacuum

Type	Input E	Output
2-way		
LWKDG 238 NW7	G 3/8" (FT)	2 x coupling sockets NW 7.2
LWKDG 212 NW7	G 1/2" (FT)	2 x coupling sockets NW 7.2
3-way		
LWKDG 338 NW7	G 3/8" (FT)	3 x coupling sockets NW 7.2
LWKDG 312 NW7	G 1/2" (FT)	3 x coupling sockets NW 7.2



Air junctions with male threads & coupling sockets NW 7.2

Materials: Body: Brass, seals: NBR

Temperature range: -20°C to max. +100°C

Operating pressure: 0 - 35 bar as well as large vacuum

Type	Input E	Output
2-way		
LWKDGDN 238 NW7	G 3/8" (MT)	2 x coupling sockets NW 7.2
LWKDGDN 212 NW7	G 1/2" (MT)	2 x coupling sockets NW 7.2
3-way		
LWKDGDN 338 NW7	G 3/8" (MT)	3 x coupling sockets NW 7.2
LWKDGDN 312 NW7	G 1/2" (MT)	3 x coupling sockets NW 7.2



Air junctions with coupling plugs & coupling sockets NW 7.2

Materials: Body: Brass, seals: NBR

Temperature range: -20°C to max. +100°C

Operating pressure: 0 - 35 bar as well as large vacuum

Type	Input E	Output
2-way		
LWKDGKS 238 NW7	Coupling plug NW 7.2	2 x coupling sockets NW 7.2
LWKDGKS 212 NW7	Coupling plug NW 7.2	2 x coupling sockets NW 7.2
3-way		
LWKDGKS 338 NW7	Coupling plug NW 7.2	3 x coupling sockets NW 7.2
LWKDGKS 312 NW7	Coupling plug NW 7.2	3 x coupling sockets NW 7.2




Pipeline sockets with coupling sockets NW 7.2

Materials: Body: Brass, seals: NBR

Temperature range: -20°C to max. +100°C

Operating pressure: 0 - 35 bar as well as large vacuum

Type	Input E	Output
brass		
WDKDG 38 MS NW7	G 3/8" (FT)	1 x coupling socket NW 7.2
WDKDG 12 MS NW7	G 1/2" (FT)	1 x coupling socket NW 7.2
WDKDG 34 MS NW7	G 3/4" (FT)	1 x coupling socket NW 7.2

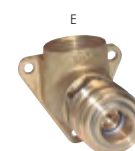


Pipeline sockets/air junctions with coupling sockets NW 7.2

Materials: Body: Brass, seals: NBR

Temperature range: -20°C to max. +100°C

Operating pressure: 0 - 35 bar as well as large vacuum

Type	Input E	Output
brass		
WDKDG 12 LW3 MS NW7	2 x G 1/2" FT	3 x coupling sockets NW 7.2

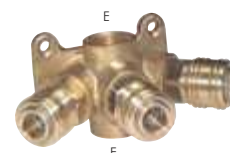

Pipeline sockets/air junctions with coupling sockets NW 7.2

Materials: Body: Plastic, brass, seals: NBR

Temperature range: -10°C to max. +50°C

Operating pressure: 0 - 15 bar as well as low vacuum

Type	Type	Input thread
with 2 coupling sockets	with 3 coupling sockets	above
WDKDG 12 LW2 NW7	WDKDG 12 LW3 NW7	G 1/2"
WDKDG 34 LW2 NW7	WDKDG 34 LW3 NW7	G 3/4"




with 2 coupling sockets



with 3 coupling sockets



PVC-fabric hoses with coupling & plug on page 208



Coil tubes assembled with couplings from page 200



Ball valves from page 280